

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE1OjM1OjQ3LjMzMIo7MTg1LjIxMC44Ni4yMjITQUxDQTJCTjFKSDc1OTUwOA==

C9LN14B : Lamp-Interior-Rear-Left

Connector Face

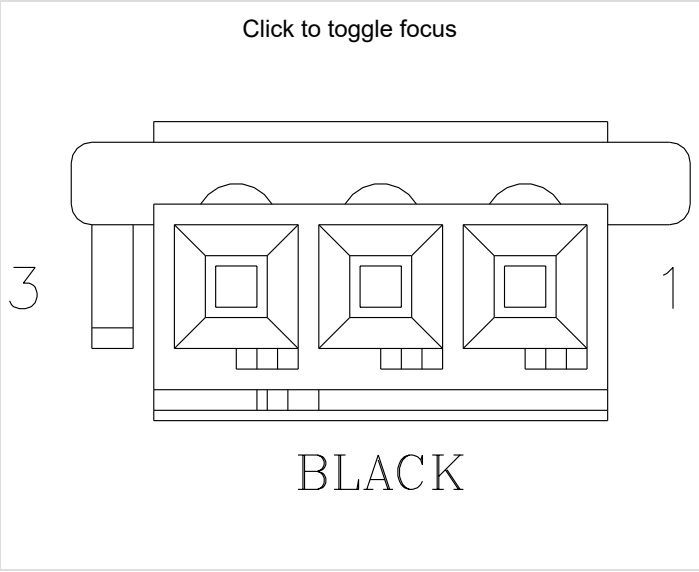

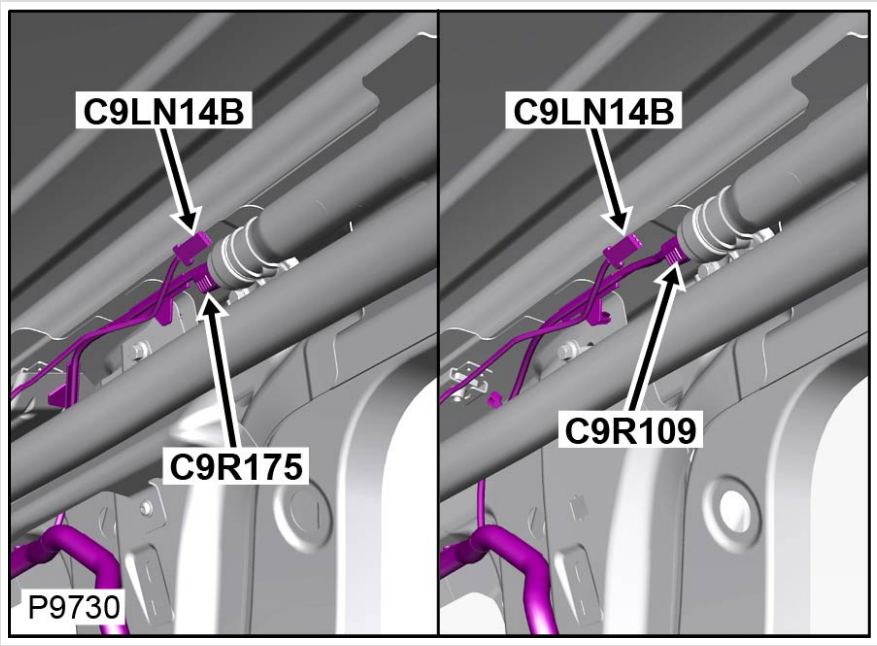

Connector
C9R109
C9R175
C9LN14B

Housing **Serviceable** **Overlay not available**

Engineering Part Number	94BG-14489-LCB
Service Part Number	YPC901790
Colour	BLACK
Cavities	3
Harness	ROOF LH HARNESS
Description	Lamp-Interior-Rear-Left
Location	Headlining - LH side

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BK-YE	ALL	S9D139C	418-498	418-595	418-116A	418-672	418-104	418-112	418-107
2	0.5	GY-VT	ALL	S9LN33A	418-498	418-595	418-116A	418-672	418-104	418-112	418-107
3	0.5	BU-GY	ALL	S9BP57A	418-498	418-595	418-116A	418-672	418-104	418-112	418-107