

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDEzOjEzOjQxLjI1MVo7MTg1LjIxMC44Ni4yMjITQUxDQTJCTjFKSDc1OTUwOA==

# C1E304AP : Ignition coil-2

**Connector Face**

Click to toggle focus

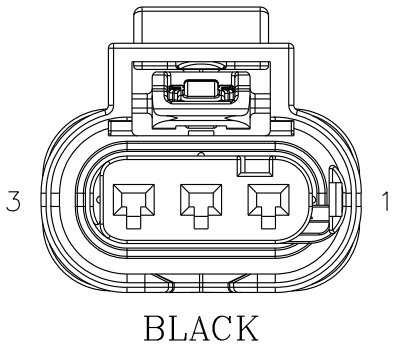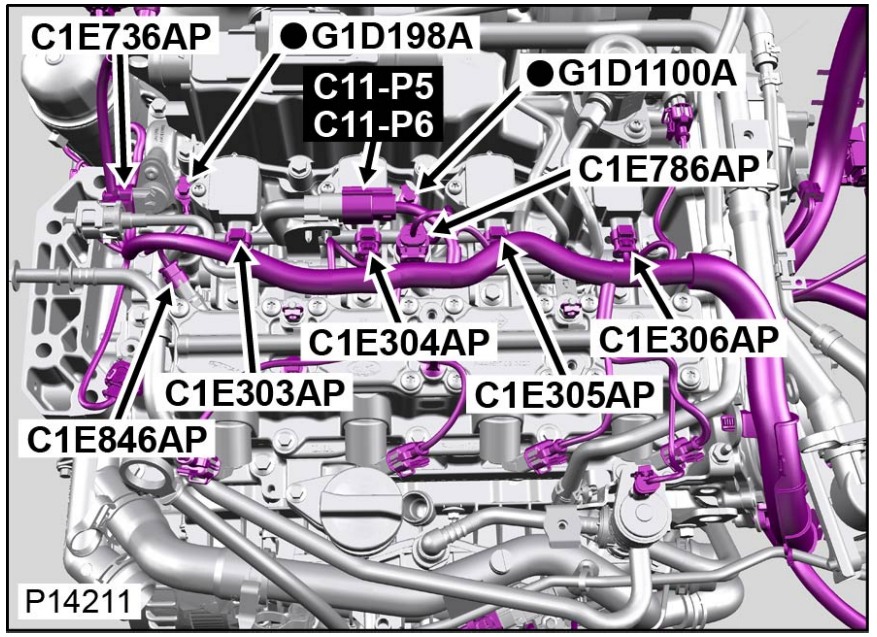


| Connector |
|---|
| G1D1100A |
| C11-P5 |
| C1E786AP |
| C1E306AP |
| C1E305AP |
| G1D198A |
| C1E304AP |
| C1E303AP |
| C1E846AP |
| C1E736AP |

| | |
|---|---|
| **Housing** | **Serviceable Overlay not available** |
| **Engineering Part Number** | DHCT-14A464-ALA |
| **Service Part Number** | LR103230 |
| **Colour** | BLACK |
| **Cavities** | 3 |
| **Harness** | ENGINE PETROL AJ200 HARNESS |
| **Description** | Ignition coil-2 |
| **Location** | Top of engine |

## Wire chart and service repair kit information

| CAV | CSA | COL | CCT | DESTN | Pre-Terminated Lead | Extract Tool | Crimpers | Wire Stripper | Heat Shrink Sleeve | Ident Sleeve | Splice |
|---|---|---|---|---|---|---|---|---|---|---|---|
| 1 | 0.5 | YE-BU | EN-U9 | C1E106A | 418-443 | 418-595 | 418-116A | 418-672 | 418-104 | 418-112 | 418-107 |
| 2 | 1.0 | BK | EN-U9 | G1D198A | 418-841 | 418-613 | 418-116A | 418-672 | 418-104 | 418-112 | 418-107 |
| 3 | 1.0 | WH-BU | EN-U9 | S1CBB06A | 418-841 | 418-613 | 418-116A | 418-672 | 418-104 | 418-112 | 418-107 |