

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDEzOjI3OjQzLjY0MVo7MTg1LjIxMC44NCI4yMjITQUxDQTJCTjFKSDc1OTUwOA==

C1LF15 : Sensor-Height-Front-Right

Connector Face

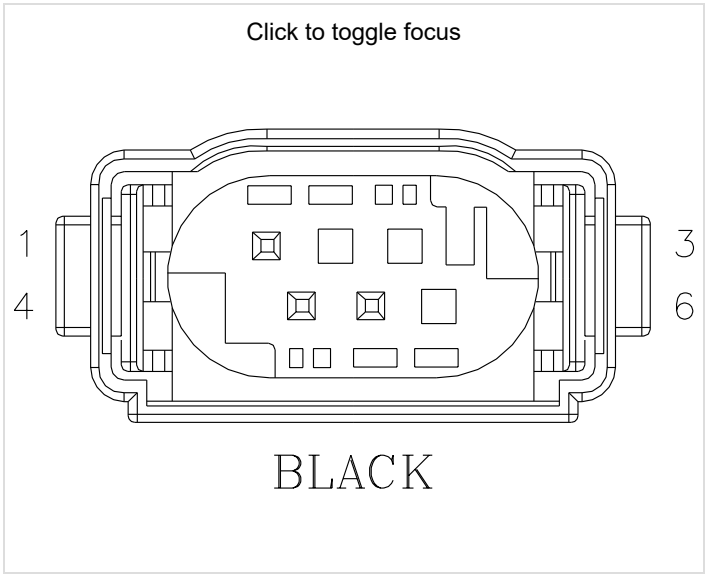

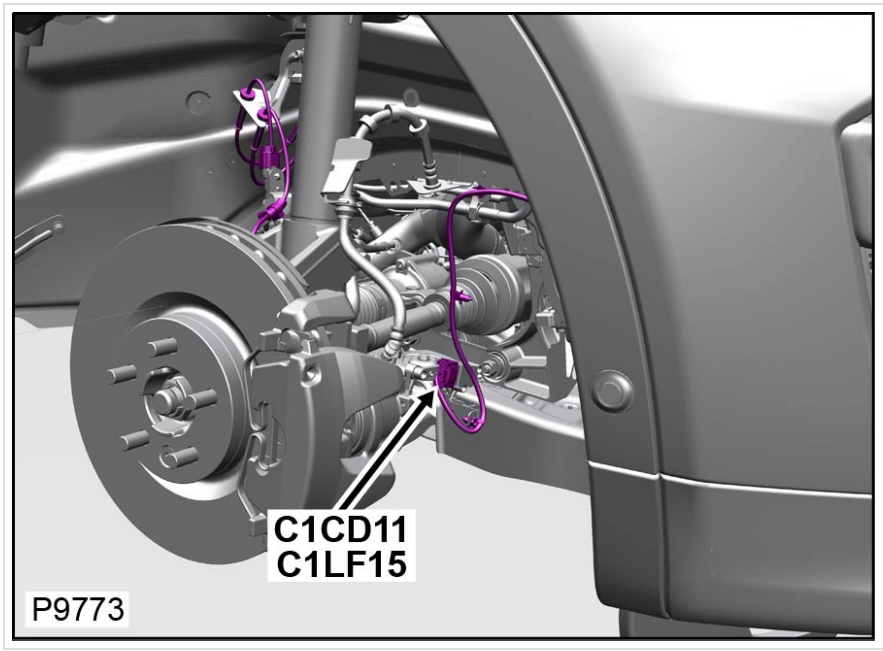

Connector
C1LF15
C1CD11

Housing	**Serviceable Overlay not available**
Engineering Part Number	AX2T-14A464-BA
Service Part Number	YPC803250
Colour	BLACK
Cavities	6
Harness	ENGINE COMPARTMENT LH HARNESS
Description	Sensor-Height-Front-Right
Location	Below Right front wheelarch

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	GN-BN	(JBBBA+DWMAA+A3BAC)/(JBBBB+DWMAA)	C2LF39	418-549-11	418-595	418-116A	418-672	418-104	418-112	418-107
4	0.35	BN	(JBBBA+DWMAA+A3BAC)/(JBBBB+DWMAA)	C2LF39	418-549-11	418-595	418-116A	418-672	418-104	418-112	418-107
5	0.35	YE-GN	(JBBBA+DWMAA+A3BAC)/(JBBBB+DWMAA)	C2LF39	418-549-11	418-595	418-116A	418-672	418-104	418-112	418-107