

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDEzOjMxOjE0LjI1MFo7MTg1LjIxMC44NzI4yMjITQUxDQTJCTjFKSDc1OTUwOA==

C22FL : Link harness to instrument panel harness

Connector Face

Click to toggle focus

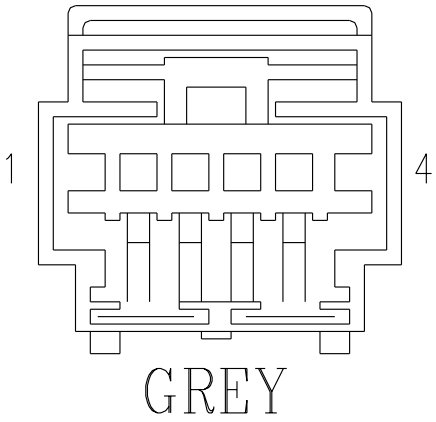

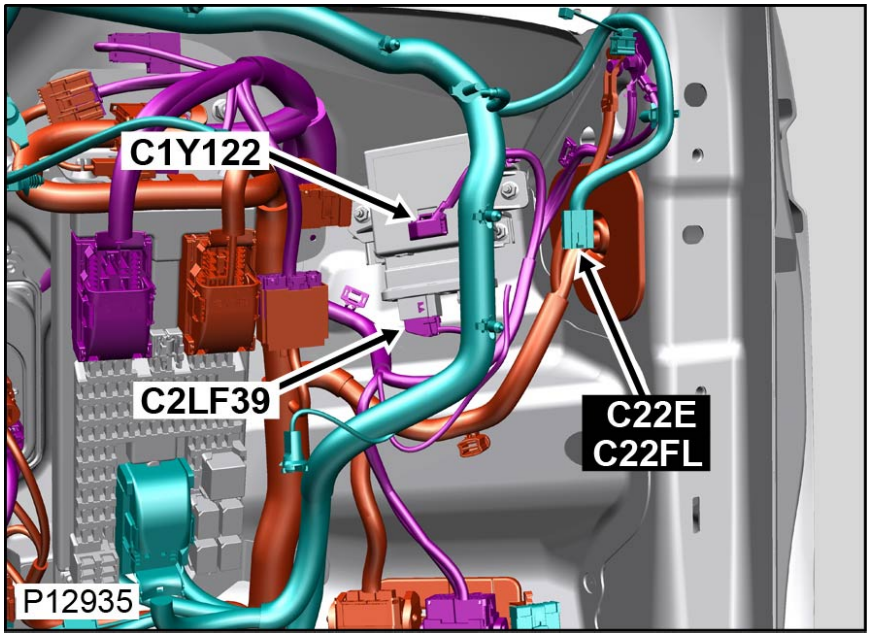

Connector
C1Y122
C2LF39
C22E
C22FL

Housing	**Serviceable Overlay not available**
Engineering Part Number	YF1T-14A624-LB
Service Part Number	YPC900630
Colour	GREY
Cavities	4
Harness	PASSENGER AIRBAG LINK HARNESS
Description	Link harness to instrument panel harness
Location	Behind passenger side of Instrument panel
Qualifier	LHD condition illustrated

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GY-BU	ADTAB+DR--F	C2R103A	418-411-12	418-595	418-116A	418-672	418-104	418-112	418-107
1	0.5	GY-BU	ADTAA+DR--F	C2R103D	418-411-12	418-595	418-116A	418-672	418-104	418-112	418-107
2	0.5	VT-GN	ADTAB+DR--F	C2R103A	418-411-12	418-595	418-116A	418-672	418-104	418-112	418-107

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	VT-GN	ADTAA+DR--F	C2R103D	418-411-12	418-595	418-116A	418-672	418-104	418-112	418-107
3	0.5	YE-GY	ADTAB+DR--F	C2R103B	418-411-12	418-595	418-116A	418-672	418-104	418-112	418-107
4	0.5	WH-BU	ADTAB+DR--F	C2R103B	418-411-12	418-595	418-116A	418-672	418-104	418-112	418-107