

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDEzOjQxOjA0Ljc2NIo7MTg1LjMC44Ni4yMjtTQUxDQTJCTjFKSDc1OTUwOA==

C2R115D : Clockspring

Connector Face

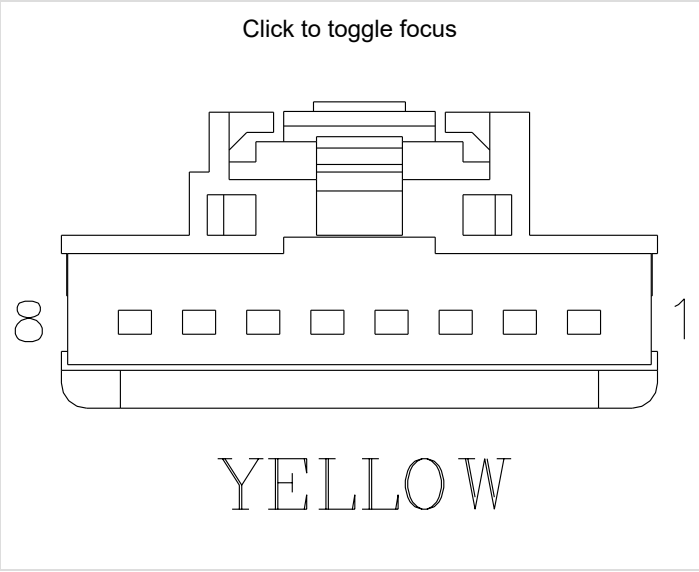

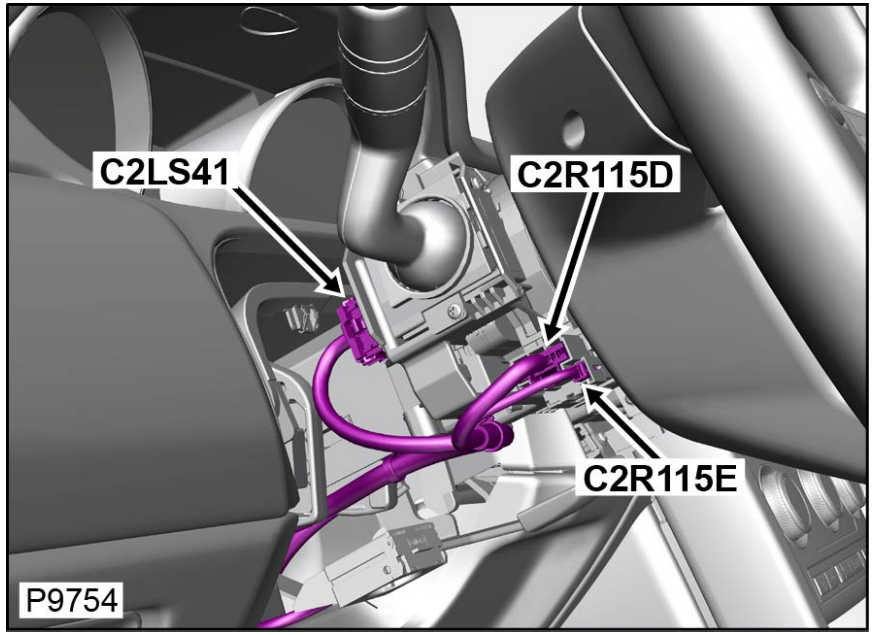

Connector
C2LS41
C2R115D
C2R115E

Housing **Serviceable** **Overlay not available**

Engineering Part Number	EJ3T-14489-HA
Service Part Number	LR066263
Colour	YELLOW
Cavities	8
Harness	INSTRUMENT PANEL LHD HARNESS
Description	Clockspring
Location	Behind steering column cowl - LH side
Qualifier	LHD condition illustrated

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BU	ADTAB	C2R114C	418-411-70	418-595	418-116A	418-672	418-104	418-112	418-107
2	0.5	WH	ADTAB	C2R114C	418-411-70	418-595	418-116A	418-672	418-104	418-112	418-107
4	0.5	VT-BN	ADTAB	C2R114C	418-411-70	418-595	418-116A	418-672	418-104	418-112	418-107

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
5	0.5	YE-GN	ADTAB	C2R114C	418-411-70	418-595	418-116A	418-672	418-104	418-112	418-107
7	0.5	BU	ADTAA	C2R114C	418-411-70	418-595	418-116A	418-672	418-104	418-112	418-107
8	0.5	WH	ADTAA	C2R114C	418-411-70	418-595	418-116A	418-672	418-104	418-112	418-107