

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE1OjIyOjE3Ljc1NIo7MTg1LjIxMC44Ni4yMjItTQUxDQTJCTjFKSDc1OTUwOA==

C4MP15A : Sensor-Park assist-Rear-Left

Connector Face

Click to toggle focus

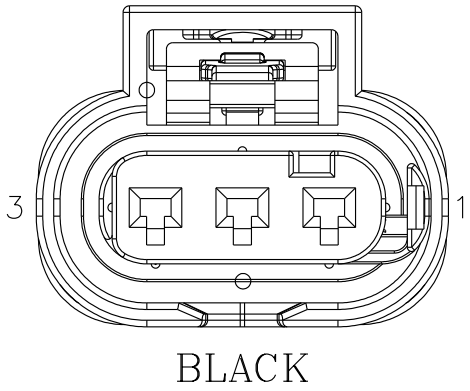

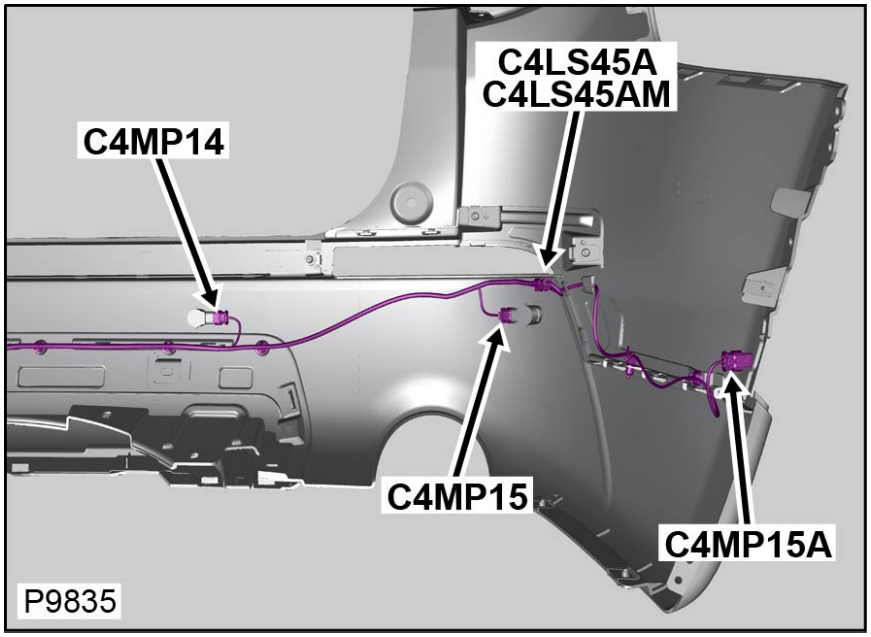

Connector
C4MP14
C4MP15A
C4LS45AM
C4LS45A
C4MP15

Housing	**Serviceable Overlay not available**
Engineering Part Number	CHCT-14A464-BKA
Service Part Number	LR066340
Colour	BLACK
Cavities	3
Harness	REAR BUMPER HARNESS
Description	Sensor-Park assist-Rear-Left
Location	Behind Left side of rear bumper

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BU-WH	HNSAC	S4MP07A	418-347	418-595	418-116A	418-672	418-104	418-112	418-107
2	0.35	YE-GN	HNSAC	C44J	418-347	418-595	418-116A	418-672	418-104	418-112	418-107
3	0.35	GN-WH	HNSAC	S4MP07B	418-347	418-595	418-116A	418-672	418-104	418-112	418-107