

C4MP16 : Sensor-Parking aid-Inner-Rear-Right

Connector Face

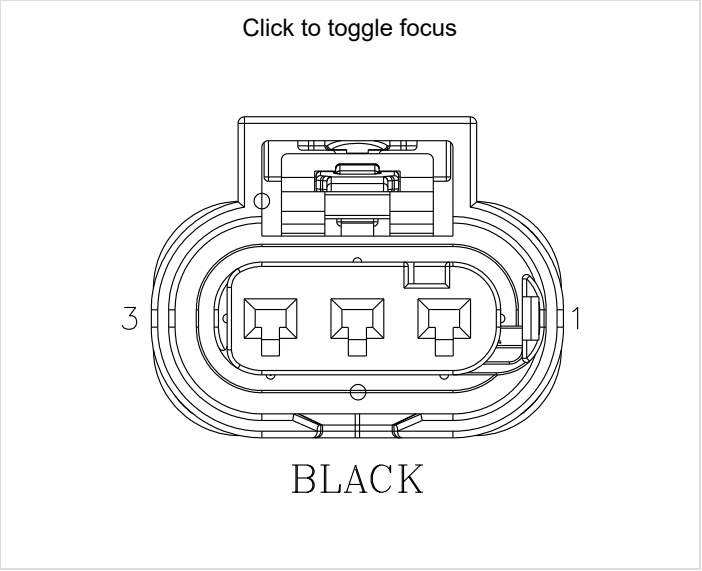

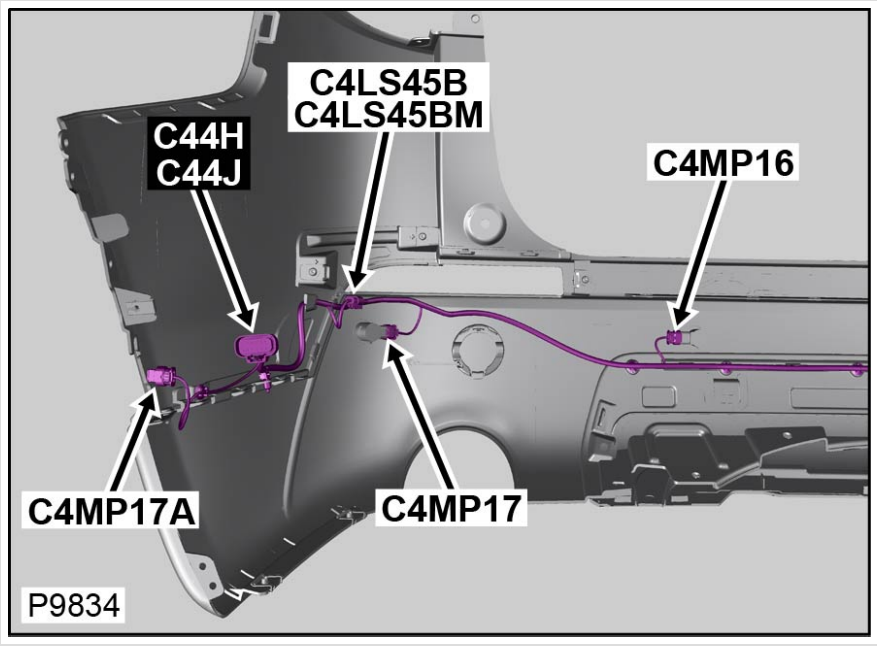

Connector
C44J
C4MP17A
C4LS45BM
C44H
C4LS45B
C4MP16
C4MP17

Housing	**Serviceable** **Overlay not available**
Engineering Part Number	CHCT-14A464-BKA
Service Part Number	LR066340
Colour	BLACK
Cavities	3
Harness	REAR BUMPER HARNESS
Description	Sensor-Parking aid-Inner-Rear-Right
Location	Behind Right side of rear bumper

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BU-WH	HNKAB	S4MP07A	418-347	418-595	418-116A	418-672	418-104	418-112	418-107
2	0.35	YE-GY	HNKAB	C44J	418-347	418-595	418-116A	418-672	418-104	418-112	418-107
3	0.35	GN-WH	HNKAB	S4MP07B	418-347	418-595	418-116A	418-672	418-104	418-112	418-107