

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE1OjMxOjAwLjcwMIo7MTg1LjIxMC44NI4yMjtTQUxDQTJCTjFKSDc1OTUwOA==

C7PK11 : Door latch-Rear-Left

Connector Face

Click to toggle focus

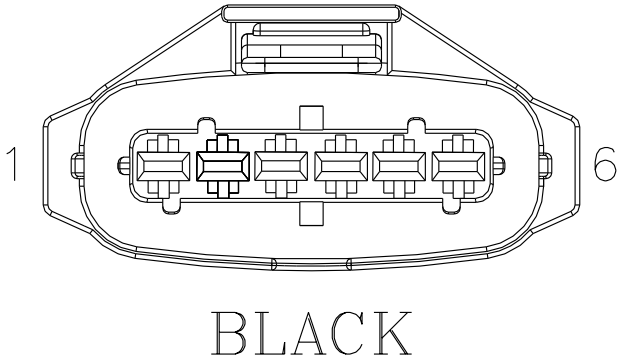

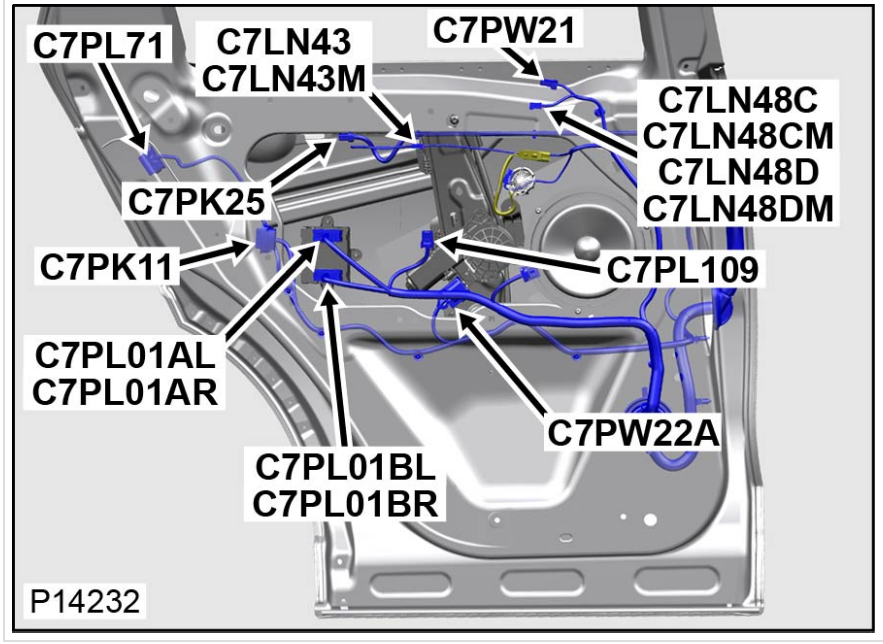

Connector
C7LN48D
C7LN48C
C7LN43
C7PL71
C7PL01AR
C7PL109
C7PW22A
C7PK11
C7PL01BR
C7PL01AL
C7PK25
C7PL01BL
C7LN43M
C7LN48DM
C7LN48CM

Housing	**Serviceable Overlay not available**
Engineering Part Number	DK5T-14A464-AA
Service Part Number	YPC915040
Colour	BLACK
Cavities	6
Harness	REAR DOOR LHS HARNESS
Description	Door latch-Rear-Left
Location	Behind LH rear door trim panel

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	BK	CBGAL	C37C	418-298	418-614	418-116A	418-672	418-104	418-113	418-108
2	1.5	BK	CBGAL	C37C	418-298	418-614	418-116A	418-672	418-104	418-113	418-108
5	0.5	BK	CBGAL	S7D133A	418-279	418-614	418-116A	418-672	418-104	418-112	418-107
6	0.5	BK	CBGAL	C37C	418-279	418-614	418-116A	418-672	418-104	418-112	418-107