

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE1OjMzOjMwLjE0M1o7MTg1LjIxMC44Ni4yMjtTQUxDQTJCTjFKSDc1OTUwOA==

C8PL01BR : Module-Rear door-Right

Connector Face

Click to toggle focus

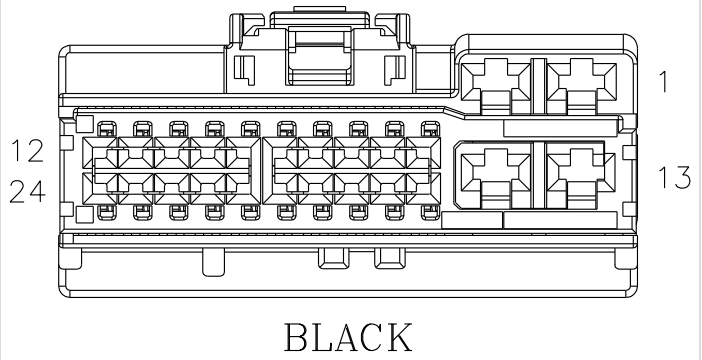

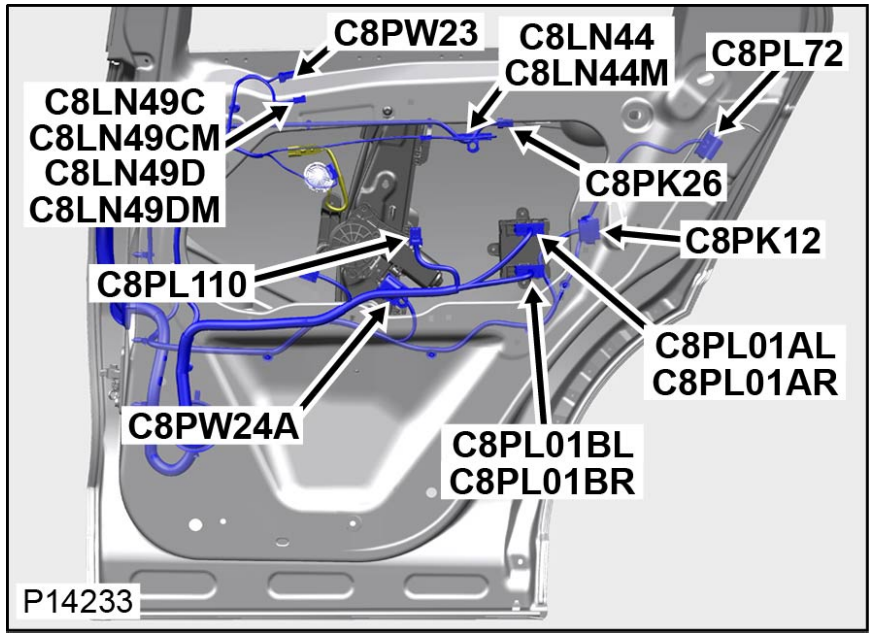

Connector
C8PW24A
C8LN49C
C8PL72
C8PL110
C8PL01BL
C8PL01AL
C8LN49D
C8PW23
C8LN44M
C8PL01BR
C8PL01AR
C8LN49CM
C8LN44
C8LN49DM
C8PK26
C8PK12

Housing	**Serviceable Overlay not available**
Engineering Part Number	CHCT-14489-JFA
Service Part Number	LR067994
Colour	BLACK
Cavities	24
Harness	REAR DOOR RHS HARNESS
Description	Module-Rear door-Right
Location	Behind RH rear door trim panel

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	2.5	BK	DR--H	S8D138A	418-264	-	418-116A	418-672	418-104	418-113	418-108
7	0.35	BK	DR--H	C8PW24A	418-832	-	418-116A	418-672	418-104	418-112	418-107
8	0.35	BK	DR--H	C8PW24A	418-832	-	418-116A	418-672	418-104	418-112	418-107

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
9	0.35	BK	DR--H	C8PW24A	418-832	-	418-116A	418-672	418-104	418-112	418-107
10	0.35	BK	DR--H	C8PW24A	418-832	-	418-116A	418-672	418-104	418-112	418-107
14	2.5	BK	DR--H	C38C	418-264	-	418-116A	418-672	418-104	418-113	418-108
15	0.13	BK	DR--H	C38C	418-250	418-595	418-116A	418-672	418-104	418-112	418-107
16	0.13	BK	DR--H	C38C	418-250	418-595	418-116A	418-672	418-104	418-112	418-107
17	0.35	BK	CBSAE+DR--H	C8PL72	418-832	-	418-116A	418-672	418-104	418-112	418-107
19	0.35	BK	DR--H	C8PL72	418-832	-	418-116A	418-672	418-104	418-112	418-107