

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE1OjM1OjMwLjg5NIo7MTg1LjIxMC44NI4yMjITQUxDQTJCTjFKSDc1OTUwOA==

C99E : Roof harness to roof link harness

Connector Face

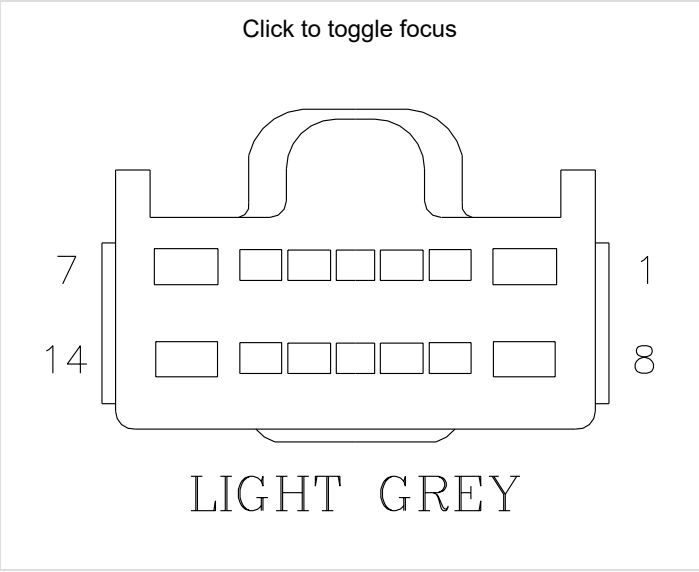

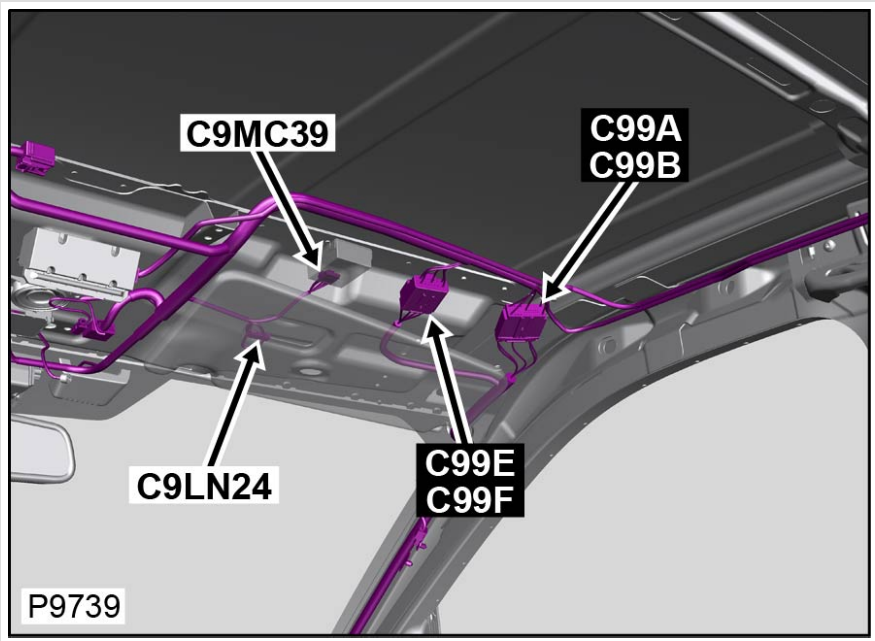

Connector
C99B
C99A
C9LN24
C9MC39
C99F
C99E

Housing **Serviceable** **Overlay not available**

Engineering Part Number 4S7T-14489-YRA

Service Part Number YPC910190

Colour GREY

Cavities 14

Harness ROOF LH HARNESS

Description Roof harness to roof link harness

Location Headlining - Front RH side

Qualifier LHD condition illustrated

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	BK-GN	B3MAB	S9D140	418-100	418-595	418-116A	418-672	418-105	418-114	418-109
2	1.5	WH-RD	A1GAP	C39D	418-248	418-665	418-116A	418-672	418-104	418-112	418-107
3	0.5	BK	HKKAF	C39D	418-411-13	418-595	418-116A	418-672	418-104	418-112	418-107

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
4	0.5	BK	HKKAF	C39D	418-411-13	418-595	418-116A	418-672	418-104	418-112	418-107
5	0.5	BK	HKKAF	C39D	418-411-13	418-595	418-116A	418-672	418-104	418-112	418-107
6	0.5	BK	HKKAF	C39D	418-411-13	418-595	418-116A	418-672	418-104	418-112	418-107
7	0.5	BK	HKKAF	C39D	418-411-46	418-595	418-116A	418-672	418-104	418-112	418-107
8	0.5	BK	HKKAF	C39D	418-411-46	418-595	418-116A	418-672	418-104	418-112	418-107
9	0.5	BK	HKKAF	C39D	418-411-13	418-595	418-116A	418-672	418-104	418-112	418-107
10	0.5	BK	HKKAF	C39D	418-411-13	418-595	418-116A	418-672	418-104	418-112	418-107
11	0.35	BU-GY	BSHDF	C39D	418-411-13	418-595	418-116A	418-672	418-104	418-112	418-107
12	0.35	BN	BSHDF	C39D	418-411-13	418-595	418-116A	418-672	418-104	418-112	418-107