

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE1OjM1OjM5LjkxMFo7MTg1LjIxMC44Ni4yMjITQUxDQTJCTjFKSDc1OTUwOA==

C9H413 : Sensor-Humidity

Connector Face

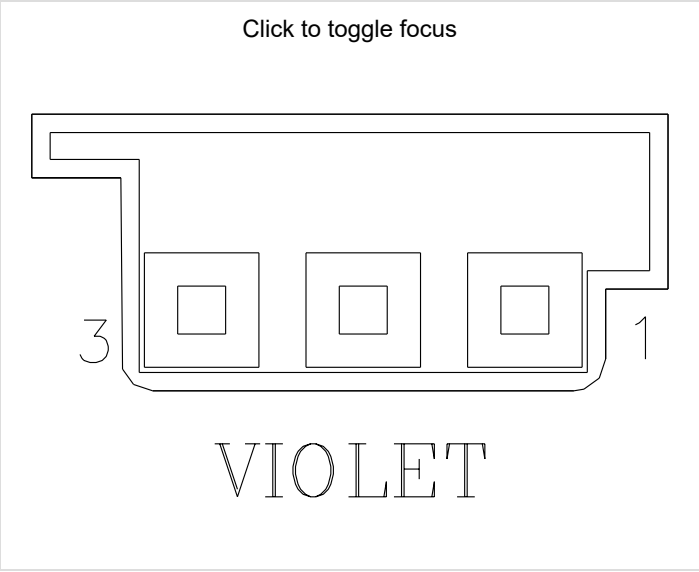

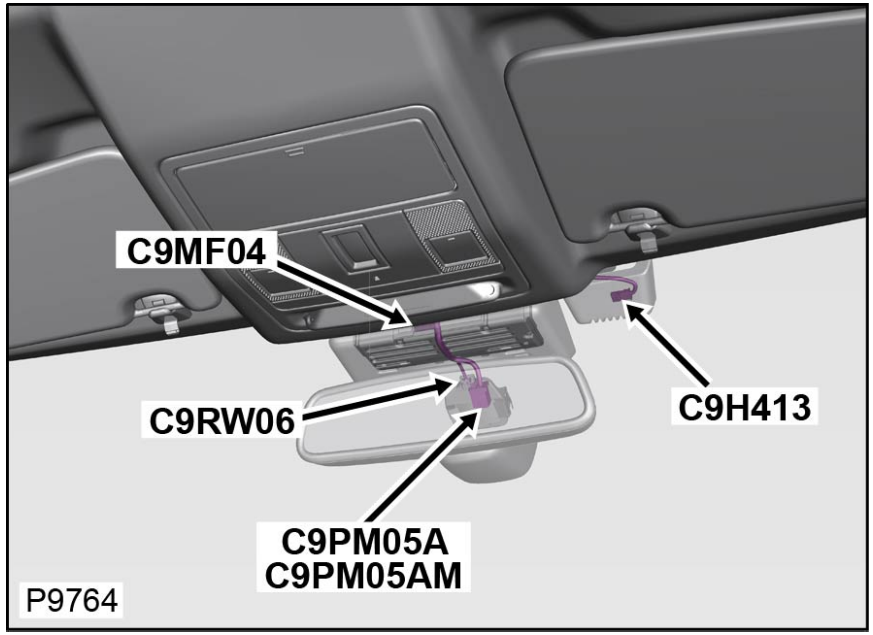

Connector
C9MF04
C9PM05A
C9PM05AM
C9H413
C9RW06

Housing	**Serviceable Overlay not available**
Engineering Part Number	3M5T-14489-CCB
Service Part Number	YPC911600
Colour	VIOLET
Cavities	3
Harness	ROOF LH HARNESS
Description	Sensor-Humidity
Location	Top of windshield

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BK-YE	G3AAK	S9D139B	418-497	-	418-116A	418-672	418-104	418-112	418-107
2	0.13	WH-GN	G3AAK	C99B	-	-	-	-	-	-	-
3	0.35	BU-OG	G3AAK	S9BP31	418-497	-	418-116A	418-672	418-104	418-112	418-107