

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE1OjM3OjUxLjYxMlo7MTg1LjIxMC44NzI4yMjITQUxDQTJCTjFKSDc1OTUwOA==

C9PR153 : Motor-Roof blind-Front

Connector Face

Click to toggle focus

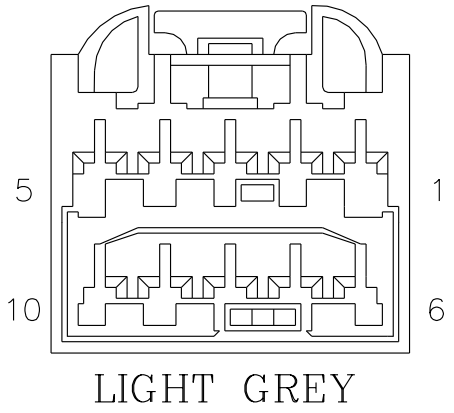

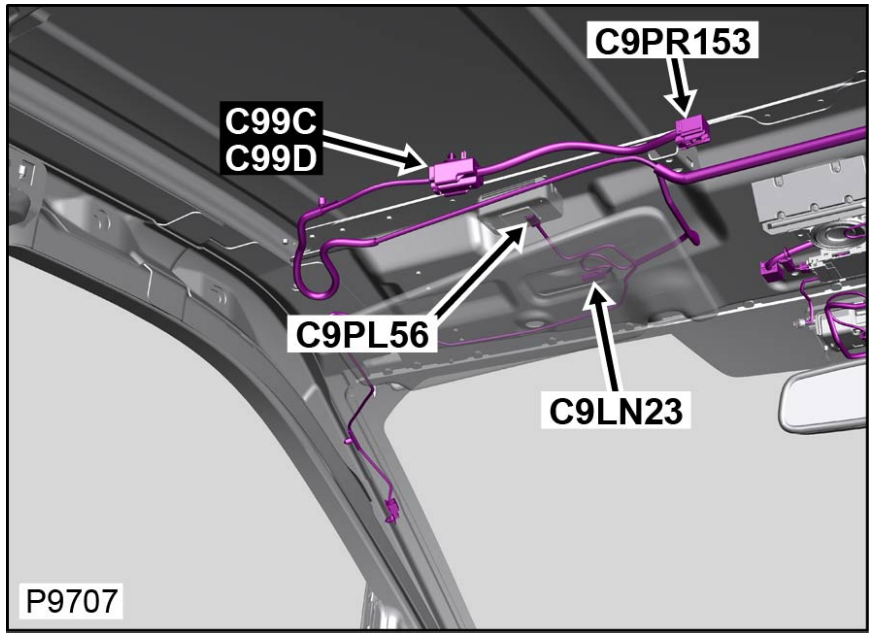

Connector
C9LN23
C9PR153
C99D
C9PL56
C99C

Housing	**Serviceable Overlay not available**
Engineering Part Number	4S7T-14489-VJA
Service Part Number	YPC910600
Colour	GREY
Cavities	10
Harness	ROOF LINK HARNESS
Description	Motor-Roof blind-Front
Location	Headlining - Front LH side
Qualifier	LHD condition illustrated

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	WH-RD	A1GAP	C99D	418-248	418-665	418-116A	418-672	418-104	418-112	418-107
3	0.35	GN-WH	A1GAP	C99D	418-717	-	418-116A	418-672	418-104	418-112	418-107
8	0.35	GN-WH	A1GAP	C99D	418-717	-	418-116A	418-672	418-104	418-112	418-107

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
9	0.35	GY-BN	A1GAP	C99D	418-717	-	418-116A	418-672	418-104	418-112	418-107
10	1.5	BK-YE	A1GAP	C99D	418-248	418-665	418-116A	418-672	418-104	418-112	418-107