

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE0OjAyOjAwLjY3NVo7MTg1LjIxMC44NzI4MjItTQUxDQTJCTjFKSDc1OTUwOA==

C3ME118AA : Panel-Audio Video Input-Output

Connector Face

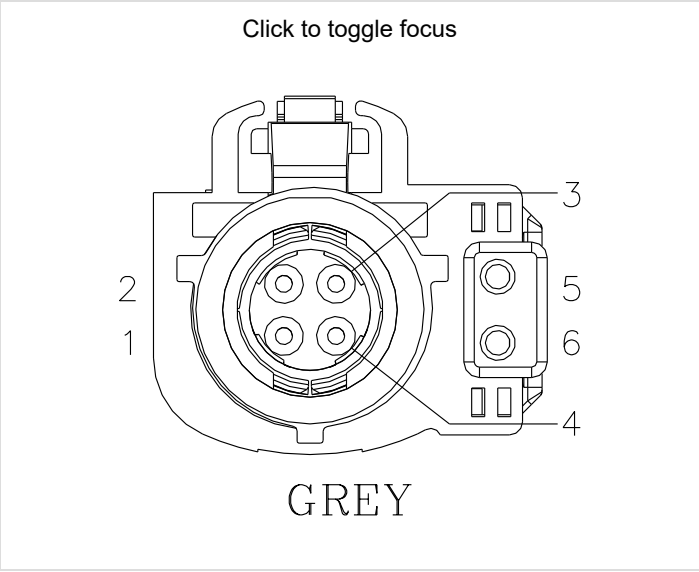

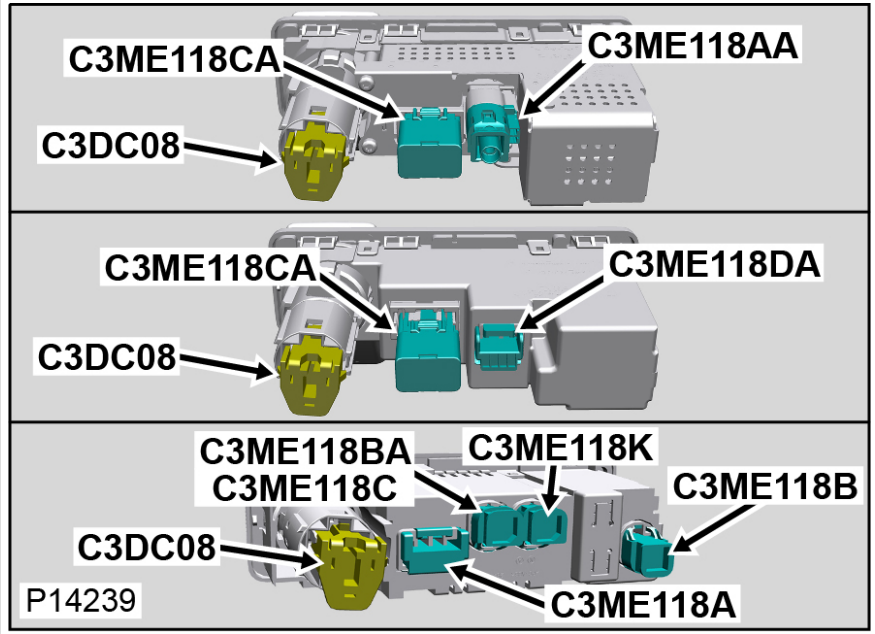

Connector

- C3ME118DA
- C3ME118CA
- C3ME118BA
- C3DC08
- C3ME118A
- C3ME118C
- C3ME118B
- C3ME118AA
- C3ME118K

Housing	**Not Serviceable** **Overlay not available**
Engineering Part Number	CHCT-14489-ETA
Service Part Number	
Colour	GREY
Cavities	6
Harness	INSTRUMENT PANEL LHD HARNESS
Description	Panel-Audio Video Input-Output
Location	In rear of center console

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN
1	0.14	BN	(ICRAD+IEPAD)/(ICRAD+IEPAA+IEXAD)	C3MA01C
2	0.14	GN	(ICRAD+IEPAD)/(ICRAD+IEPAA+IEXAD)	C3MA01C
3	0.14	OG	(ICRAD+IEPAD)/(ICRAD+IEPAA+IEXAD)	C3MA01C
4	0.14	BU	(ICRAD+IEPAD)/(ICRAD+IEPAA+IEXAD)	C3MA01C

CAV	CSA	COL	CCT	DESTN
5	0.75	GN	(ICRAD+IEPAD)/(ICRAD+IEPAA+IEXAD)	C32F
6	0.5	BK	(ICRAD+IEPAD)/(ICRAD+IEPAA+IEXAD)	S2D134E
SCR	0.14	SCR	(ICRAD+IEPAD)/(ICRAD+IEPAA+IEXAD)	C3MA01C