

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDEzOjMwOjQxLjAyNVo7MTg1LjIxMC44Ni4yMjITQUxDQTJCTjFKSDc1OTUwOA==

C21B : Engine compartment harness to instrument panel harness

Connector Face

Click to toggle focus

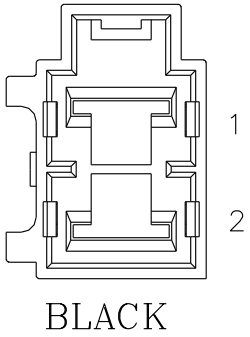

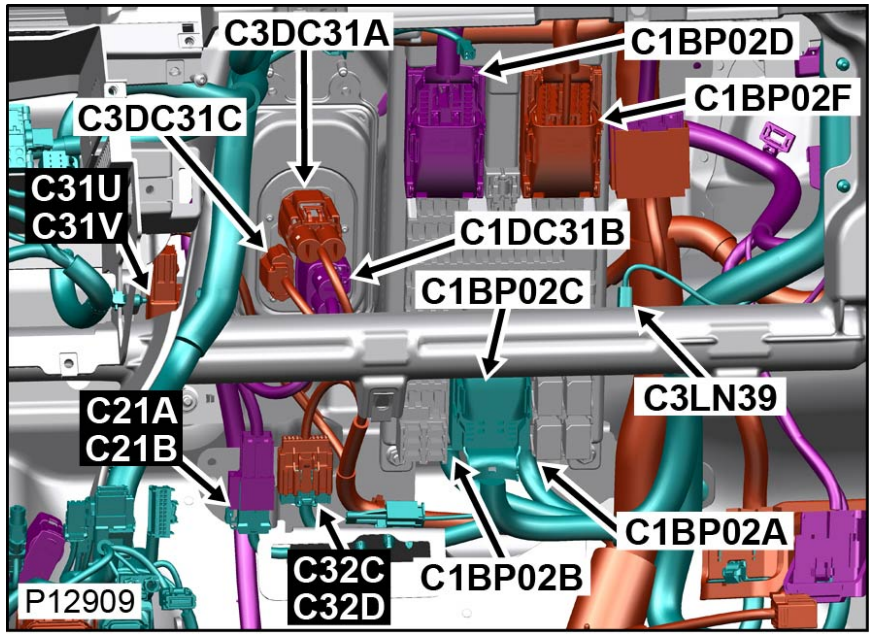

Connector
C1BP02D
C21A
C1BP02B
C1BP02C
C1BP02A
C31V
C1DC31B
C31U
C1BP02F
C3DC31C
C3DC31A
C32D
C32C
C3LN39
C21B

Housing	**Serviceable** **Overlay not available**
Engineering Part Number	EHCT-14A459-ATA
Service Part Number	YPC909020
Colour	BLACK
Cavities	2
Harness	ENGINE COMPARTMENT LH HARNESS
Description	Engine compartment harness to instrument panel harness
Location	Behind passenger side of Instrument panel
Qualifier	LHD condition illustrated

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	GY-VT	ALL	C1BB01A	418-387	-	418-116A	418-672	418-105	418-114	418-109