

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE0OjAzOjMwLjI3MVo7MTg1LjIxMC44NHI4yMjtTQUxDQTJCTjFKSDc1OTUwOA==

C3ME23C : Module-Audio amplifier

Connector Face

Click to toggle focus

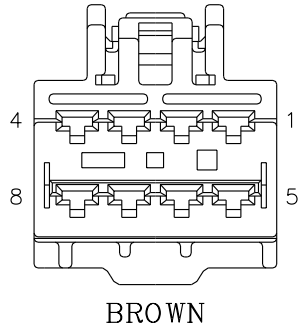

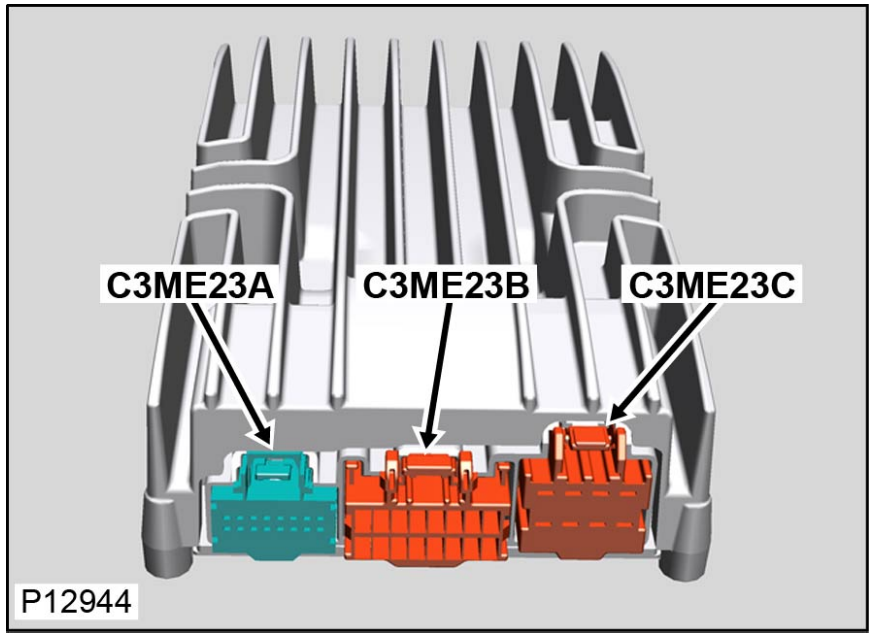

Connector
C3ME23B
C3ME23A
C3ME23C

Housing **Serviceable** **Overlay not available**

Engineering Part Number CHCT-14489-EXA

Service Part Number LR066288

Colour BROWN

Cavities 8

Harness CABIN LH HARNESS

Description Module-Audio amplifier

Location Beneath LH Front seat

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	1.5	GN-RD	IDAAJ	S3BRB12	418-317	418-595	418-116A	418-672	418-104	418-113	418-108
4	1.5	BK-GY	IDAAJ	S3D135	418-317	418-595	418-116A	418-672	418-104	418-113	418-108
6	1.5	GN-RD	IDAAJ	S3BRB12	418-317	418-595	418-116A	418-672	418-104	418-113	418-108
8	1.5	BK-GY	IDAAJ	S3D135	418-317	418-595	418-116A	418-672	418-104	418-113	418-108