

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE0OjA4OjM0LjI5MVo7MTg1LjIxMC44Ni4yMjITQUxDQTJCTjFKSDc1OTUwOA==

C3R116A : Sensor-Occupant detection

Connector Face

Click to toggle focus

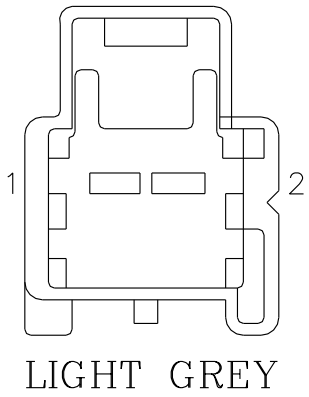

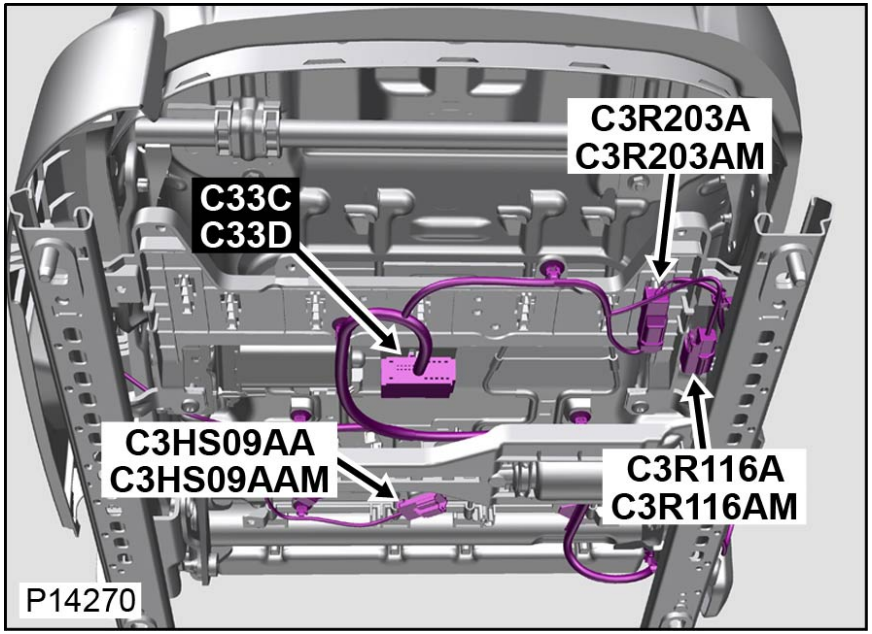

Connector
C3R116AM
C3HS09AA
C3R203A
C3R116A
C33D
C3HS09AAM

Housing **Serviceable** **Overlay not available**

Engineering Part Number 4S7T-14A459-VAA

Service Part Number YPC908580

Colour GREY

Cavities 2

Harness SEAT MANUAL PASSENGER LHD HARNESS

Description Sensor-Occupant detection

Location Beneath front passenger seat

Qualifier LHD condition illustrated

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	WH	CP5AB	C33D	418-411-12	418-595	418-116A	418-672	418-104	418-112	418-107
2	0.35	WH	CP5AB	C33D	418-411-12	418-595	418-116A	418-672	418-104	418-112	418-107