

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE0OjExOjQ0LjQ1N1o7MTg1LjIxMC44NI4yMjtTQUxDQTJCTjFKSDc1OTUwOA==

C44BG : Chassis harness to main harness

Connector Face

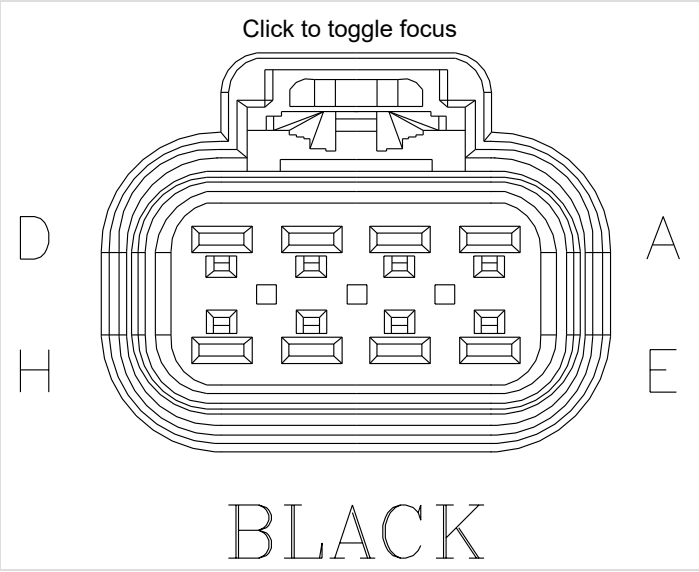

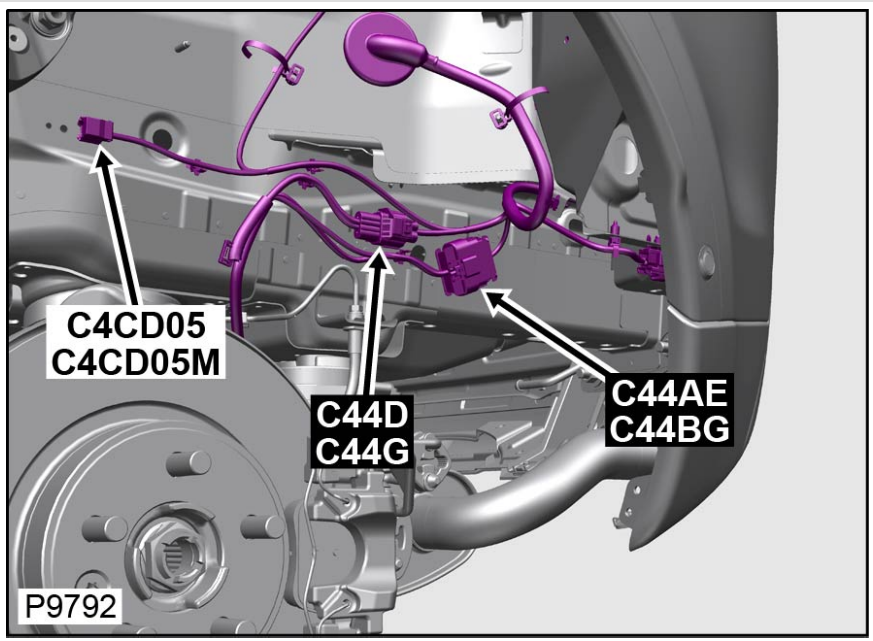

Connector
C44BG
C4CD05
C4CD05M
C44G
C44D
C44AE

Housing **Not Serviceable** **Overlay not available**

Engineering Part Number GHCT-14A464-BDA

Service Part Number

Colour BLACK

Cavities 8

Harness CHASSIS REAR HARNESS

Description Chassis harness to main harness

Location Below Left rear wheelarch

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN
A	0.5	BU-OG	ALL	C4CA04A
B	0.5	BN-GN	ALL	C4CA04A
C	0.35	BU-RD	DWMAD	C4CD12
D	0.35	VT-WH	DWMAD	C4CD12

CAV	CSA	COL	CCT	DESTN
E	0.35	VT-GN	DWMAD	C4CD12
F	0.75	BN	EN-U8+BYNAL+D17AQ+CLFB5	C4E183B
G	0.5	VT	EN-U8+BYNAL+D17AQ+CLFB5	C4E183B
H	0.5	BK-GY	EN-U8+BYNAL+D17AQ+CLFB5	C4E183B