

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE1OjE5OjIyLjcwNVo7MTg1LjIxMC44Ni4yMjItTQUxDQTJCTjFKSDc1OTUwOA==

C4LN17B : Lamp-Luggage compartment-Right

Connector Face

Click to toggle focus

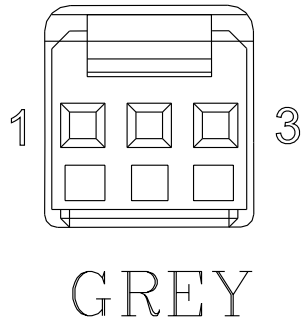

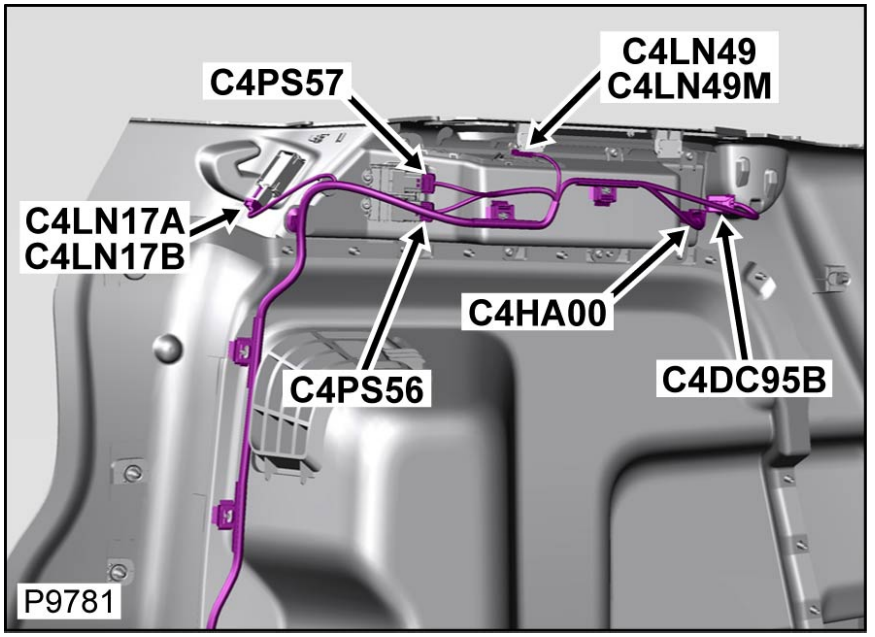

Connector
C4PS57
C4PS56
C4LN49M
C4LN17A
C4HA00
C4LN17B
C4DC95B
C4LN49

Housing	**Serviceable** **Overlay not available**
Engineering Part Number	A6FN-14489-BA
Service Part Number	YPC914260
Colour	GREY
Cavities	3
Harness	LOAD SPACE TRIM RHS HARNESS
Description	Lamp-Luggage compartment-Right
Location	Behind loadspace side trim panel - Right

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GY-VT	BWCAR	C44BD	418-231	418-595	418-116A	418-672	418-104	418-112	418-107
2	0.5	BK-BU	BWCAR	S4D152A	418-231	418-595	418-116A	418-672	418-104	418-112	418-107