

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE1OjIyOjM4LjM4MIo7MTg1LjIxMC44Ni4yMjITQUxDQTJCTjFKSDc1OTUwOA==

C4MP19AA : Camera-Rear view

Connector Face

Click to toggle focus

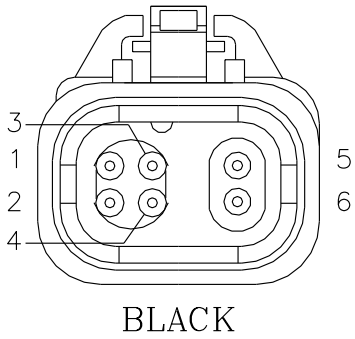

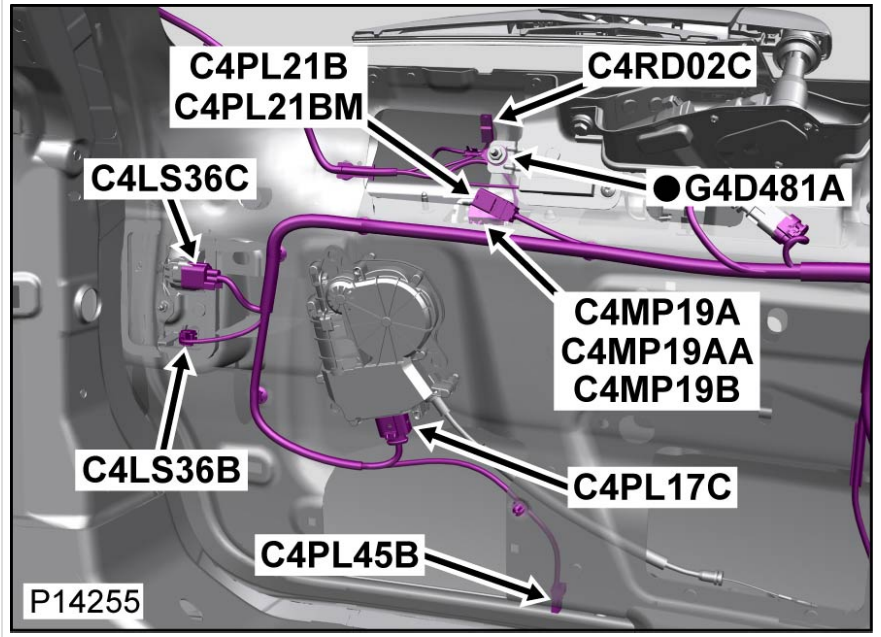

Connector
C4LS36B
G4D481A
C4PL17C
C4MP19B
C4MP19A
C4MP19AA
C4LS36C
C4PL21BM
C4PL45B
C4RD02C
C4PL21B

Housing **Not Serviceable** **Overlay not available**

Engineering Part Number EHCT-14A464-CEA

Service Part Number

Colour BLACK

Cavities 6

Harness TAILGATE ICE HARNESS

Description Camera-Rear view

Location RH side of tailgate, behind trim panel

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN
1	0.35	BK	ICRAD+J3KAB	C49M
2	0.35	BK	ICRAD+J3KAB	C49M
3	0.35	BK	ICRAD+J3KAB	S4D152B
4	0.35	BK	ICRAD+J3KAB	C49M

CAV	CSA	COL	CCT	DESTN
5	0.08	GN	ICRAD+J3KAB	C49K
6	0.08	BU	ICRAD+J3KAB	C49K
SCR	0.5	SCR	ICRAD+J3KAB	C49K