

c2JpbGV0c2t5aTsyMDIxLTA2LTAyVDE1OjI2OjA3LjEzNlo7MTg1LjIxMC44NiI4yMjtTQUxDQTJCTjFKSDc1OTUwOA==

# C4PL17C : Actuator-Tailgate

**Connector Face**

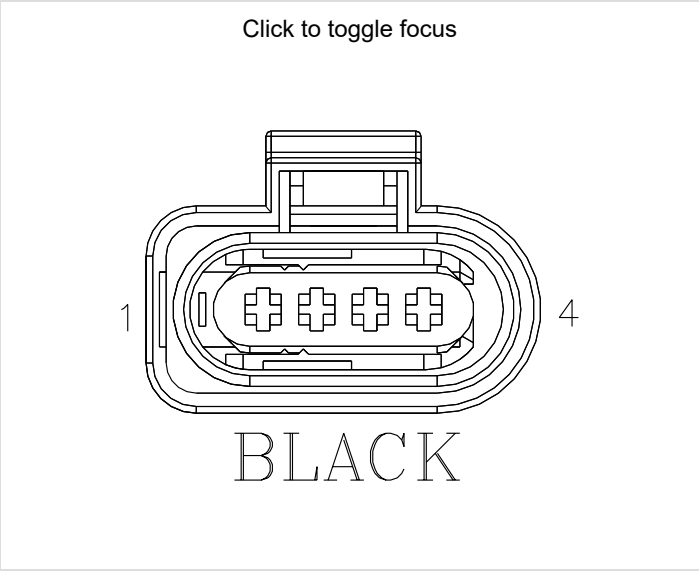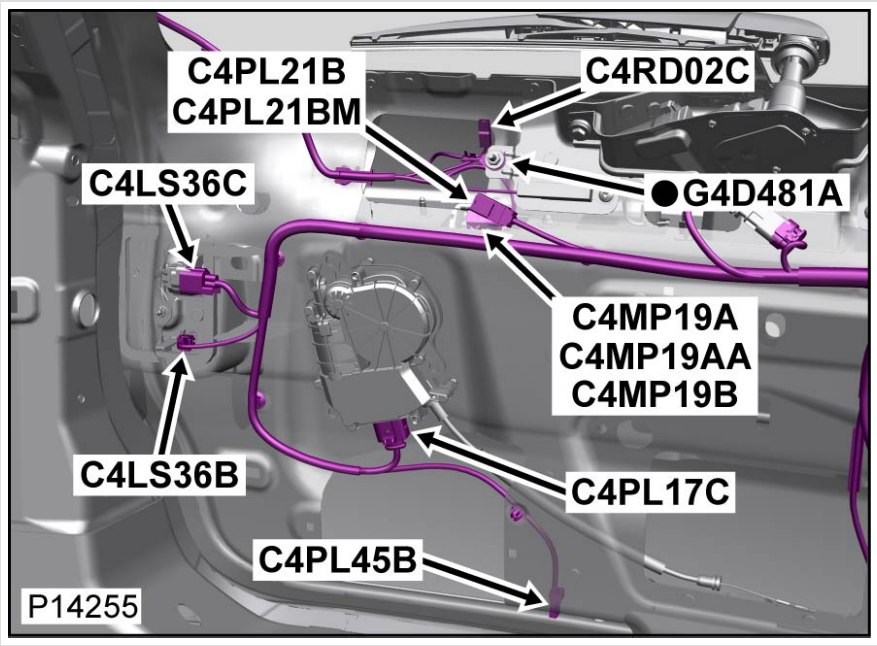


| Connector |
|---|
| C4LS36B |
| G4D481A |
| C4PL17C |
| C4MP19B |
| C4MP19A |
| C4MP19AA |
| C4LS36C |
| C4PL21BM |
| C4PL45B |
| C4RD02C |
| C4PL21B |

| | |
|---|---|
| **Housing** | **Serviceable Overlay not available** |
| **Engineering Part Number** | DK5T-14A464-KA |
| **Service Part Number** | YPC916920 |
| **Colour** | BLACK |
| **Cavities** | 4 |
| **Harness** | TAILGATE HARNESS |
| **Description** | Actuator-Tailgate |
| **Location** | RH side of tailgate, behind trim panel |

## Wire chart and service repair kit information

| CAV | CSA | COL | CCT | DESTN | Pre-Terminated Lead | Extract Tool | Crimpers | Wire Stripper | Heat Shrink Sleeve | Ident Sleeve | Splice |
|---|---|---|---|---|---|---|---|---|---|---|---|
| 1 | 0.5 | BK | A7AAE | C4PL20B | 418-604 | - | 418-116A | 418-672 | 418-104 | 418-112 | 418-107 |
| 2 | 0.75 | BK | A7AAE | S4D151D | 418-371 | 418-658 | 418-116A | 418-672 | 418-104 | 418-112 | 418-107 |
| 3 | 0.75 | BK | A7AAE | C4PL20A | 418-371 | 418-658 | 418-116A | 418-672 | 418-104 | 418-112 | 418-107 |
| 4 | 0.75 | BK | A7AAE | C4PL20A | 418-371 | 418-658 | 418-116A | 418-672 | 418-104 | 418-112 | 418-107 |